



INSTALLATION NOTICE

#416

Ford Police Interceptor 3.3L Installation Notice
NAPA Gold Oil Filter 7502

NAPA Gold Oil Filter	OE #	Application
7502	AA5Z-6714-B	Ford Police Interceptor 3.3L

- It has been identified that during installation of the oil filter in the Ford Police Interceptor (3.3L Full Hybrid EV-Gas (FHEV), 3.5L Gas, and 3.7L Flex Engines) the clamp hose next to the filter base can shift and align with the filter roll seam. When this occurs, the filter may not be tightened adequately and result in leakage.
- **IMPROVEMENT ACTIVITY:** To prevent this failure mode, visually inspect the area where hoses are clamped at the base. If the hose clamp bracket is aligned with the oil filter base, slightly rotate it away from the base/roll seam area.

